

Work Order ID 148827

July 08, 2016 2:27:31 PM

148827

To ship ASAP.
July 15.

Page 1

Item ID: D145-762-013

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Skidtube with Standard Wearplates Fits LH or RH

Start Date: 7/8/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 7/15/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan: SH

Date: 7/8/16

Tooling:

Date:

Run

Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

IIN-D117-762

E

SH

7/8/16

copy.

DAS
21
9-89

16-10-13

101

0.00

101

0.00

DC

Memo

Doc.Control -USB or Paperwork

REPLACE WITH NEW DECAL THAT SAYS "CHG 3 W/DSI9731-011 KIT"

DAS
27
9-89

DEC 12 2016

105

0.00

105

0.00

Skidtubes

Memo

Skidtubes

PULL D145-762-013 B128543 X1 CHG 3 FROM QUARANTINE

REMOVE ALL D3492-055 PLUG ASSEMBLIES

~~FILL QTY 2.00.297 GROUNDING STRAP HOLES WITH WELD AND REDRILL PER D4680 REV E~~

N/A 9/16/16

16-10-13

DART		1270 ABERDEEN ST. HAWKESBURY ON, CANADA K6A 1K7 TEL 1-613-632-5200 www.dartaerospace.com	
PATENT	US #5735484 / CA #2222184 / EURO #0828655		
P.N	D145-762-013	CHG	CHG003
DESC	Skidtube STD	STC	SR01853SE
LOT	B128543	STC	
MODEL	BK117 C2	STC	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
							Completed By		
							Lead hand / Supervisor Approval Verification		
							QC / QA Coordinator Approval		

Root Cause				FAULT CATEGORY			
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong		
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions		
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance		
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect		
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing		
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved		
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing		
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish		
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread		
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence		
Past Expiry Date ☐	☐ Manufacturing Process	OTHER : _____					
Misidentified ☐	☐ Past Due						

July 08, 2016 2:27:31 PM

Page 2

N/A CP 16/5/8

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By																																																									
8/4/1 01 930								Lead hand / Supervisor Approval Verification																																																									
								QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

Work Order ID 148827

July 08, 2016 2:27:31 PM

148827

Page 3

Item ID: D145-762-013 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Skidtube with Standard Wearplates Fits LH or RH
 Start Date: 7/8/2016 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 7/15/2016 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
127		0.00							
127									
Powdercoat	Memo	0.00							
Powder Coating	PAINT FINISH PER D4680 REV E								
128		0.00							
128									
QC	QC3- Inspect Part Finish	0.00							
Quality Control	Memo	0.00							
135		0.00							
135									
HandFinish	Memo	0.00							
Hand Finishing	INSTALL DSI9731-011 GHL UPGRADE KIT PER DSI9731 REV A								

N/A 7/16/16

127 16/08/16

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

July 08, 2016 2:27:31 PM

Page 4

DEC 14 2016

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐				
Date :	Step #:	QTY Effective :			MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			Completed By	
					Lead hand / Supervisor Approval Verification	
					QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY				
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	
OTHER :						

Work Order ID 148827

July 08, 2016 2:27:31 PM

148827

Page 5

Item ID: D145-762-013

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Skidtube with Standard Wearplates Fits LH or RH

Start Date: 7/8/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 7/15/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
155	Identify as per dwg & Stock Location: _____	0.00							
155									
Packaging	Memo	0.00							
Packaging	REPLACE RED DECAL WITH NEW DECAL THAT SAYS "CHG 3 W/DSI9731-011 KIT								
165	QC21- Final Inspection - Work Order Release	0.00							
165									
QC	Memo	0.00							
Quality Control	ADD "DSI9731-011 GHL UPGRADE KIT" TO THE SKIDTUBE ARC.								

DAS
27
9-89
DEC 12 2016DAS
21
9-89

DEC 14 2016

16-12-13

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER :					

July 08, 2016 2:27:37 PM

148827

D145-762-013

Required Qty: 1.00

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

1

B128543

DAS
28
9-89

9-89

Each	0.0000
------	--------


1

GHL Upgrade


B 148830 (1c) M. 16 Color

DEC 12 2016


ITEM	QTY	P/N	DESCRIPTION
	X	D4680-041	SKIDTUBE
1	1	D2965	CAP
2	1	D2965-3	CAP
3	1	D4680-043	SKIDTUBE SUB ASSY
4	2	AN3C5A	BOLT
5	2	AN526C1032R10	SCREW
6	2	NAS1149C0332R	WASHER (AN960-10L)

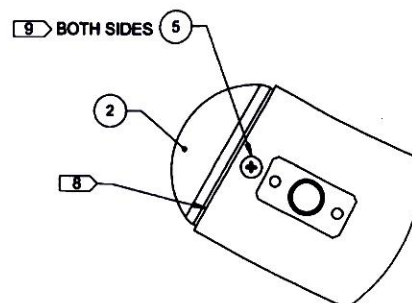

DETAIL A
SCALE 4X

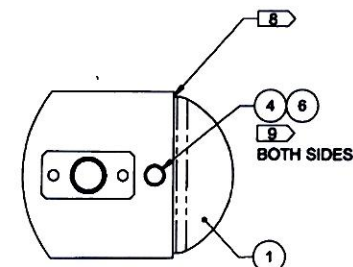

DETAIL B
SCALE 4X

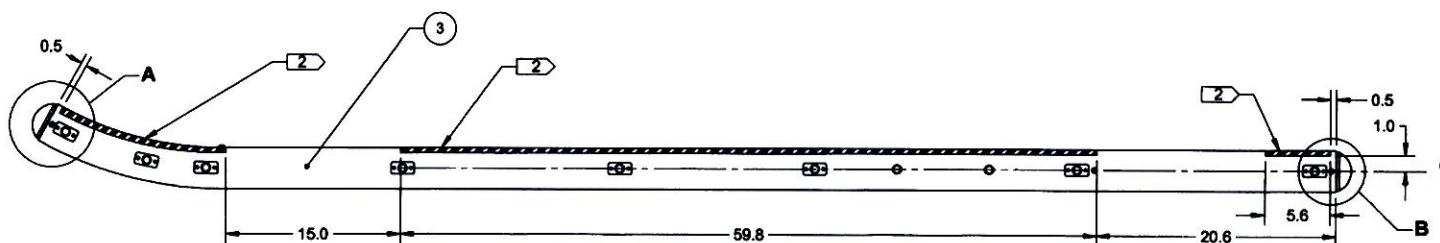

D4680-041 SKIDTUBE

NOTES:


- 1) MATERIAL: N/A
- 2) FINISH: PAINT TOP SURFACE OF SKIDTUBE WITH MIL-W-5044 ANTI-SKID PAINT (WING WALK) AS INDICATED TO 1.00 ABOVE CENTERLINE PER QSI 005 SECTION 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY WITH DART P/N "D4680-041" AND B/N PER QSI 044 METHOD 6.4 ON INNER RADIUS OF SKIDTUBE BEFORE INSTALLING D2965 CAP
- 7) WEIGHT: 18.56 lbs
- 8) SEAL FAYING SURFACES WITH SIKAFLEX -241/-291 OR PROSEAL 890 OR MIL-S-8802 CLASS B-2 SEALANT
- 9) INSTALL FASTENERS WET WITH SIKAFLEX -241/-291 OR PROSEAL 890 OR MIL-S-8802 CLASS B-2 SEALANT

E	GROUND HANDLING CROSSBOLT SPACERS NOW SWAGED, WAS WELDED. REMOVED D3492-055 PLUG ASSEMBLIES	AP	15.11.02
D	MOVED AFT GROUNDING FASTENER HOLE AFT 0.25 DUE TO INTERFERENCE, ADDED NOTE 9 (SHT 1), GROUNDING STRAP WASHERS NOW STAINLESS	AP	15.03.04
C	NAS1149C0332P WAS AN960-10L, AN526C1032R10 WAS AN526C1032-10, FWD GROUNDING STRAP FASTENER MOVED AFT (C5-3), Ø0.750 WAS Ø0.758 (B4-3).	AP	14.07.28
B	FWD CAP WAS D2965, NOW D2965-3, VARIOUS DIMENSIONAL CHANGES. D3492-055 PLUG ASSY WAS D3492-051, SWAGING DIMENSION NOW 0.850 WAS 0.861 (D6-2), ADDED DETAIL H (C2-3), MATERIAL D2962-150 WAS D2962-131 (A7-3), GROUND HANDLING THRU HOLES NOW WELDED, ADDED SECTION G-G (D3-2)	AP	13.09.10
A	NEW ISSUE	AP	13.02.13
REV.	DESCRIPTION	BY	DATE
DESIGN	AP	DART AEROSPACE USA, INC. EUGENE, OR DRAWING NO. D4680 REV. E SHEET 1 OF 3 TITLE SKIDTUBE SCALE NTS COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	
DRAWN	AP		
CHECKED	AJS		
MFG. APPR.	DD		
APPROVED	WM		
DE APPR.	DS	DATE 15.11.02	

RELEASED
2016-02-04
EW 16-514

APPROVED


ITEM	QTY	P/N	DESCRIPTION
	X	D4680-043	SKIDTUBE SUB ASSY
1	1	D4680-1	SKIDTUBE
2	1	D4681-041	WEB ASSY
3	8	D4686-1	SPACER
4	16	D4753-1	DOUBLER
5	2	D5304-1	SPACER
6	3	AELS-1032-130	INSERT
7	3	AN3C4A	BOLT
8	32	MS20601AD4W3	RIVET, BLIND, CSK
9	3	NAS1149C0332R	WASHER (AN960-10L)

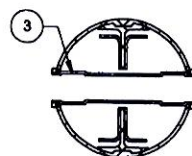

SECTION C-C
SCALE 4X
8 PL

INSTALL D4686-1 SPACER AS FOLLOWS (8 PL)
AFTER INSTALLING D4753-1 DOUBLERS PER DETAIL D

1. INSERT D4686-1 SPACER
2. SWAGE TO $\phi 0.650 +0.010/-0.000 \times 1.0$
3. DEEP PER QSI 002


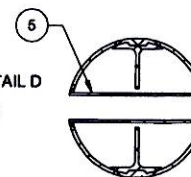


SECTION G-G
SCALE 4X
2 PL

INSTALL D5304-1 SPACER AS FOLLOWS (2 PL)


1. INSERT D5304-1 SPACER
2. SWAGE TO $\phi 0.565 +0.005/-0.000 \times 1.0$
3. DEEP PER QSI 002

OPEN THRU HOLE TO $\phi 0.625$

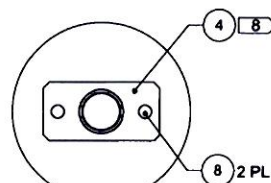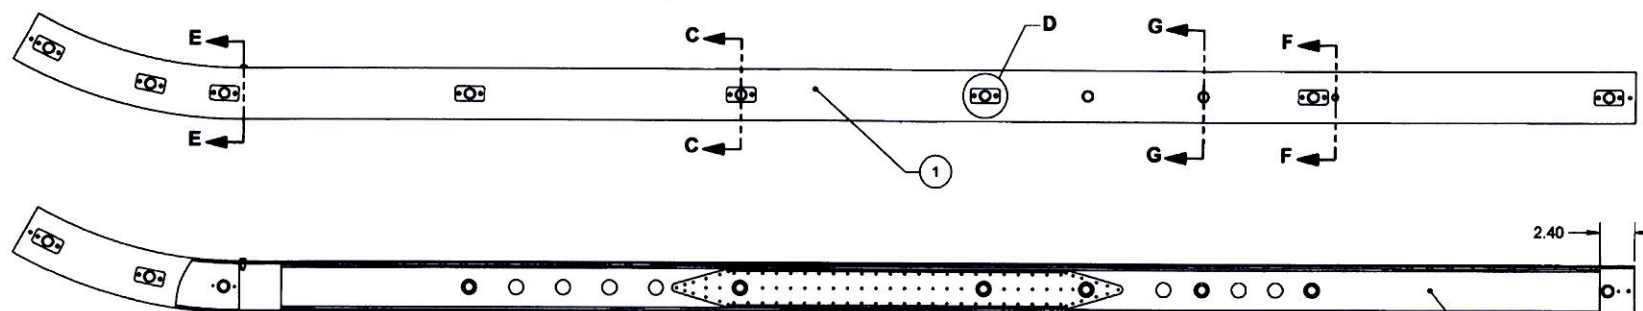


DETAIL D
16 PL (BOTH SIDES)
SCALE 4X

D4680-043 SKIDTUBE SUB ASSY

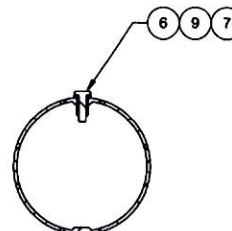

SECTION E-E
SCALE 2.5X

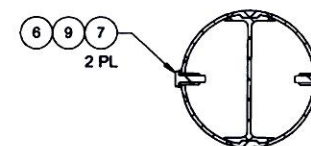

SECTION F-F
SCALE 2.5X


NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: APPLY CHEMICAL CONVERSION COATING PER DART QSI 005 4.1 PRIOR TO INSTALLING D4681-041 WEB.
POWDER COAT WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: 17.91 lbs
- 8) SEAL ALL MATING SURFACES USING PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT
- 9) INSERT D4681-041 WEB INTO D4680-1 SKIDTUBE IN LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX -241/-291 ADHESIVE PER DART QSI 015
- 10) INSTALL D4686-1 SPACER AFTER INSTALLING D4753-1 DOUBLERS



RELEASED
2016-02-04

APPROVED


DESIGN	AP	DART AEROSPACE USA, INC.	
DRAWN	AP	EUGENE, OR	
CHECKED	AJS	DRAWING NO.	REV. E
MFG. APPR.	DD	D4680	SHEET 2 OF 3
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	SKIDTUBE	NTS
DATE	15.11.02	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC.	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

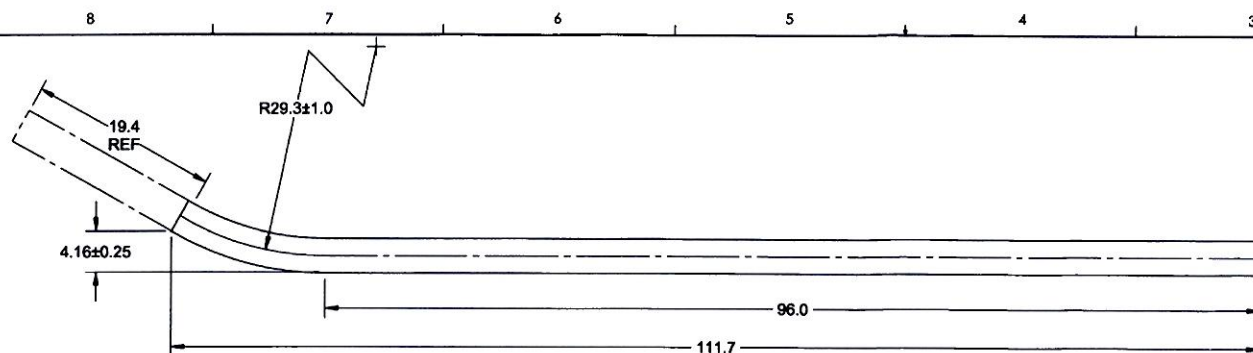


D4680-1 SKIDTUBE BENDING/TRIMMING DETAIL

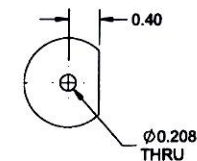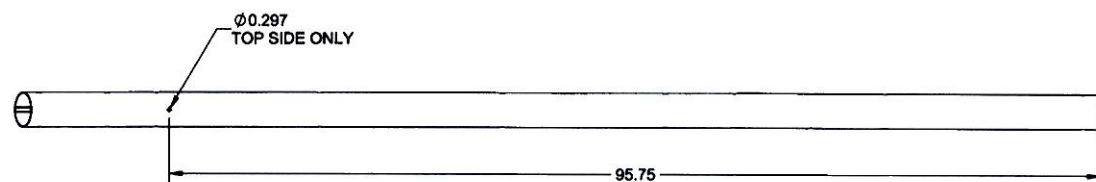

DETAIL H
SCALE 8X
2 PL

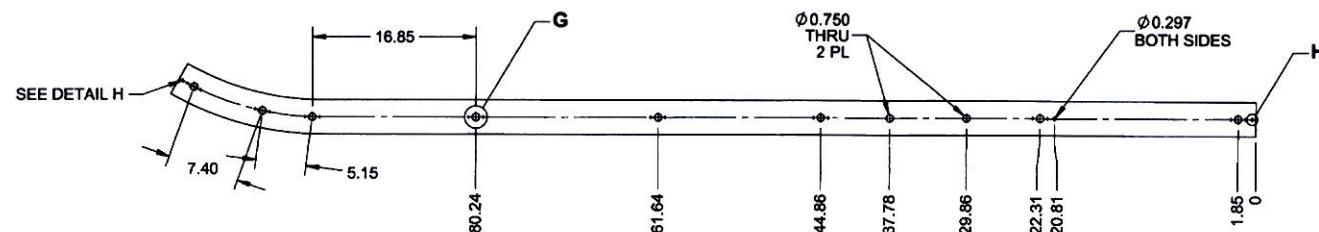

D4680-1 SKIDTUBE DRILLING DETAIL

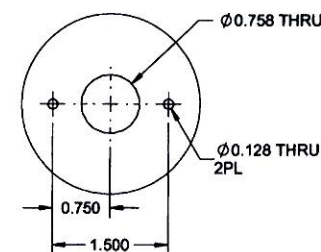

DETAIL G
SCALE 8X
8 PL

NOTES:

- 1) MATERIAL: MAKE FROM D2962-150 EXTRUSION
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: 11.36 lbs

RELEASED
2016-02-04

APPROVED

DESIGN	AP	DART AEROSPACE USA, INC.	
DRAWN	AP	EUGENE, OR	
CHECKED	AJS	DRAWING NO.	REV. E
MFG. APPR.	DD	D4680	SHEET 3 OF 3
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	SKIDTUBE	NTS
DATE	15.11.02	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DART SERVICE INSTRUCTION

TO AMEND INSTALLATION INSTRUCTIONS IIN-D117-762 REV. D AND
INSTRUCTIONS FOR CONTINUED AIRWORTHINESS ICA-D117-762 REV. 3

REF FAA STC: SR01853SE

REF: TC LETTER OF ACCEPTANCE RDIMS-4374899

REF EASA STC: EASA.10017063

1.0 PURPOSE

The purpose of this Dart Service Instruction (DSI) is to replace the ground handling lugs (D3864-1 Bushings, AN6C51A Bolts and MS21043-6 Nuts) on the D145-762-XXX Skid tubes with a structurally superior lug design. This service instruction only affects D145-762-043/-013/-113 Skid tubes at change 004 or earlier and D145-762-045/-015/-115 Skid tubes at change 001. It is highly recommended to install DSI 9731-011 GHL Upgrade Kit in order to prevent early structural failure of the D145-762-XXX Skid tubes. Each DSI 9731-011 GHL Upgrade Kit provides the necessary parts and hardware for installation on one skid tube.

2.0 INSTALLATION

- 2.1 Remove (qty 4) D3864-1 Bushings per Skid tube by removing (qty 2) AN6C51A Bolts and (qty 2) MS21043-6 Nuts
- 2.2 Loosely install (qty 2) D5300-1 GHL Bushing & (qty 2) D5301-1 GHL Plug wet with Proseal 890 or MIL-S-8802 Class B2 Sealant in location shown in Figure 1.
- 2.3 Install AN6C52A Bolts and (qty 2) MS21043-6 Nuts in accordance with Figure 1. Clean up squeezed out Proseal and apply fillet seal around D5300-1 & D5301-1.
- 2.4 Torque AN6C52A Bolts 180 - 190 In-lbs (18.1 - 21.5 N-m).

3.0 PARTS LIST

QTY -011	PART NUMBER	DESCRIPTION
X	DSI 9731-011	GHL UPGRADE KIT
2	D5300-1	GHL BUSHING
2	D5301-1	GHL PLUG
2	AN6C52A	BOLT
2	MS21043-6	NUT

SH 148827
7/8/16

4.0 WEIGHT AND BALANCE

There is negligible weight and balance change associated with this modification.

A	NEW ISSUE	AP	15.11.02
REV.	DESCRIPTION	BY	DATE
DESIGN	AP	DART AEROSPACE, LTD	
DRAWN	AP	EUGENE, OR	
CHECKED	DB.	DRAWING NO.	REV.A
MFG. APPR.	N/A	DSI 9731	SHEET 1 OF 2
APPROVED	CH	TITLE	SCALE
DE APPR.	CH	GHL UPGRADE KIT	NTS
DATE	15.11.02	COPYRIGHT ©2015 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE, LTD.	

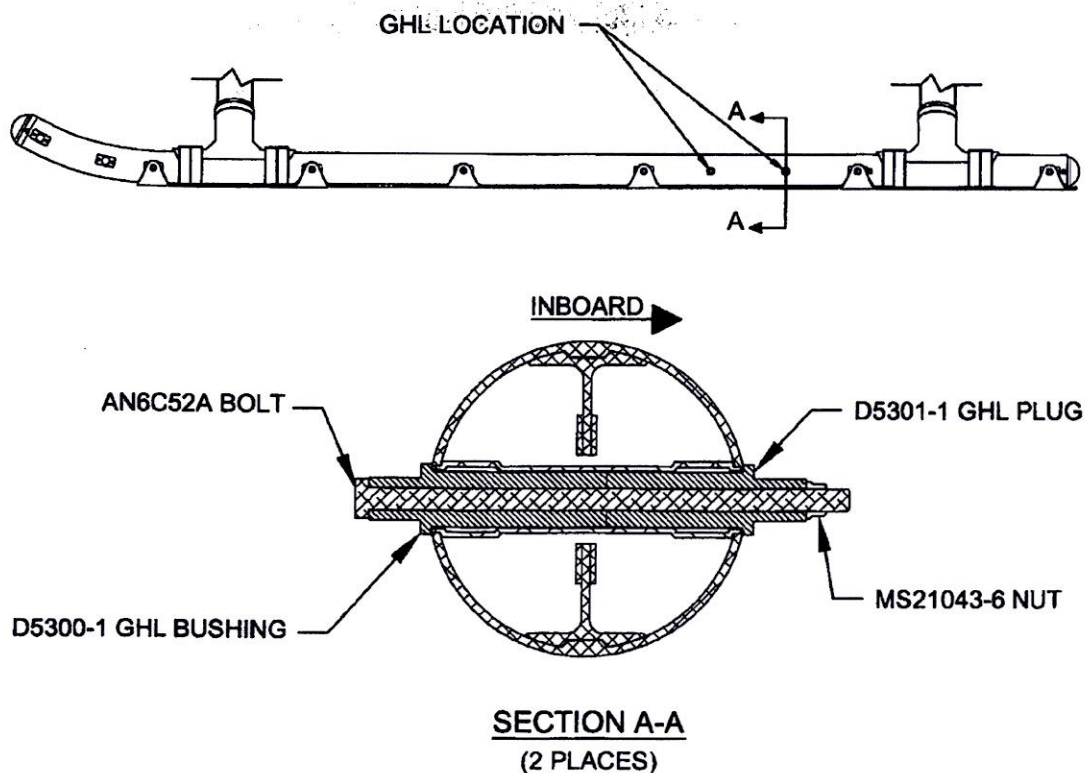


FIGURE 1 - GHL UPGRADE INSTALLATION

DESIGN	AP	DART AEROSPACE, LTD EUGENE, OR	
DRAWN	AP		
CHECKED	ASS	DRAWING NO.	REV.A
MFG. APPR.	N/A	DSI 9731	SHEET 2 OF 2
APPROVED	CM	TITLE	SCALE
DE APPR.	SH	GHU UPGRADE KIT	NTS
DATE	15.09.15	COPYRIGHT © 2015 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE, LTD.	